

NYC Department of Education
Building Condition Assessment Survey 2023 - 2024


Architectural Inspection

K402

Asset: 3K CENTER @ 1326 EAST 57 STREET - BROOKLYN, 1326 EAST 57TH STREET, 11234

Inspection Id	Inspection Type	Time In	Last Edited
SA : K402	Architectural - Senior	2024-02-07 11:45 AM	2024-02-26 9:24 AM
AA : K402	Architectural - Associate	2024-02-07 12:05 PM	2024-02-20 6:10 PM

Asset Data

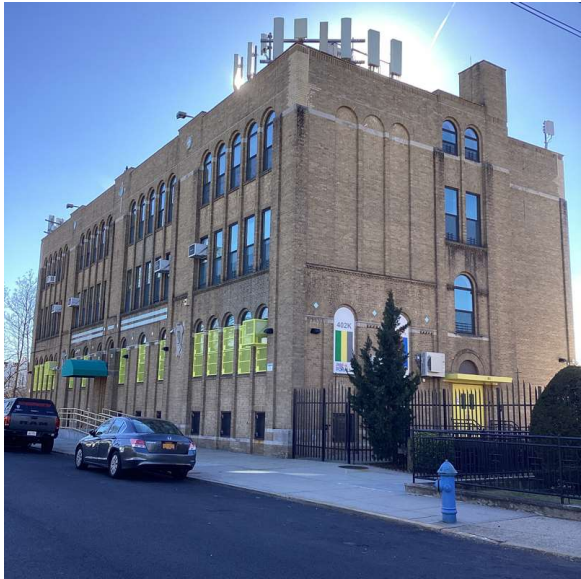Question	Answer
Was the building fully accessible for inspection	Yes
Building Square Footage	22,000
Comments on the Area (for Athletic Field, Playing Surfaces, Leased Spaces)	22,000 S.F. Leased Space, 29,500 S.F. Total Building Area
Comments on the Stories (Floors) plus Basements	4+B
Comments on the Number of Classrooms	11
Comments on the Year Built	1949
Student Population	120
Staff Population	10
Weather	Fair
Principal(s) Information	
Principal Name	Rosalie Favuzza
Organization	Community School District 22 3K Center @ 1326 East 57th Street - Brooklyn
Did you meet with this Principal?	No
Did this Principal provide feedback?	No
Custodian	Vinod Harripaul
Fireman	Keith Williams (Handyman)
Facade Photo	

East 57th Street - South View

**NYC Department of Education
Building Condition Assessment Survey 2023 - 2024**

Architectural Inspection


K402

Main Entrance Photo



Facade A - East 57th Street

Roof Photo

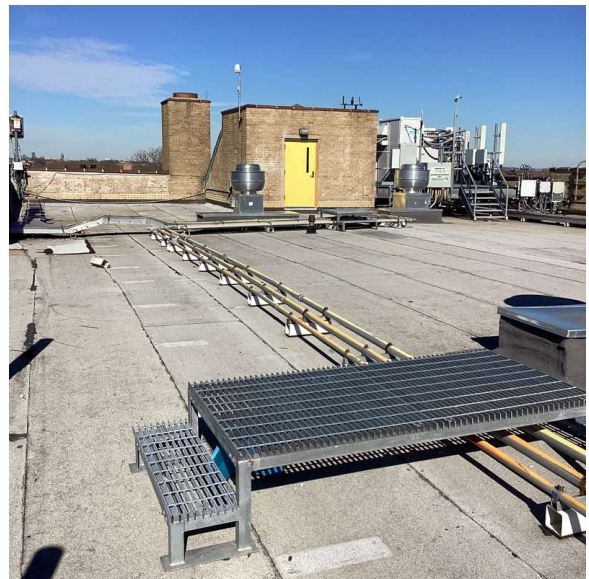

Roof 1 - North View

Have any Systems/Major Building Components been upgraded?

Yes

Systems: Exterior renovation Exterior Doors and Frames, Exterior Railing, Stairs/Ramps - repairs

Year: 2022

Systems: Windows - replacement

Year: 2000

Have there been any Building Additions?

No

Tandem Schools?

No

Leased Space?

Yes

Year Leased

2023

Inspection

Partial Inspection

Priority Condition

Priority Condition Exist Last Year?	Priority Category	Condition Description	Component Affected	Location Description	Person(s) Notified	Person(s) Title	PhotoImage
-------------------------------------	-------------------	-----------------------	--------------------	----------------------	--------------------	-----------------	------------

No condition recorded

Structural Engineer Required

NYC Department of Education
Building Condition Assessment Survey 2023 - 2024

Architectural Inspection

K402

Structural Condition Type	Condition Description	Component Affected	Location Description	Person(s) Notified	Person(s) Title	PhotoImage
No condition recorded						

Programmatic Accessibility

Programmatic Accessibility Status Question	Response
Is the primary or secondary entrance on an accessible route?	Yes
Is the building a multi-story building?	Yes
Are all floors of the building accessible through compliant means?	No
Are SOME floors other than the 1st floor and basement accessible through compliant means?	No
Do any of the following spaces exist on the 1st Floor or Basement? Classroom, Art Room, Auditorium, Cafeteria, Computer, Gymnasiums, Library, Multipurpose Room, Science Labs	Yes
For the rooms that do exist, are SOME of them accessible on the 1st Floor or Basement?	Yes
Boys and Girls or Unisex accessible toilets exist on the 1st floor?	Yes

Physical Breakdown Structure	Exists	Required	Complies	Deficiency	Assistive Fire Listening Alarm System	Strobe
------------------------------	--------	----------	----------	------------	---------------------------------------	--------

PROGRAMMATIC ACCESSIBILITY

Exterior Routes

Exterior Entrances & Exits			Yes			
Exterior H/C Lifts	No	No				
Exterior Ramps and Railings	Yes		Yes			

Interior Routes

Corridor and Lobby H/C Lifts	Yes		Yes			
Interior Corridor Doors and Hardware	Yes		Yes			
Interior Corridors and Lobbies			Yes			
Interior Elevators	No					
Interior Lobby Doors and Hardware			Yes			
Interior Ramps	Yes		Yes			

Rooms & Spaces

Art Rooms		No				
Auditorium		No				
Cafeteria		No				
Classrooms	1st Floor	Yes		Yes		
Computer Rooms		No				
Gymnasium		No				
Library		No				
Main Office	Room 105	Yes		Yes		
Multi-purpose Room	Basement	Yes		Yes	FM System	No
Nurse's Room	Room 103	Yes		Yes		
Pool		No				
Science Lab		No				
Toilet Rooms (Boys)	1st Floor	Yes		Yes		
Toilet Rooms (Girls)	1st Floor	Yes		Yes		
Toilet Rooms (Staff)	1st Floor	Yes		Yes		


NYC Department of Education
Building Condition Assessment Survey 2023 - 2024

Architectural Inspection

K402

Building Template

K402

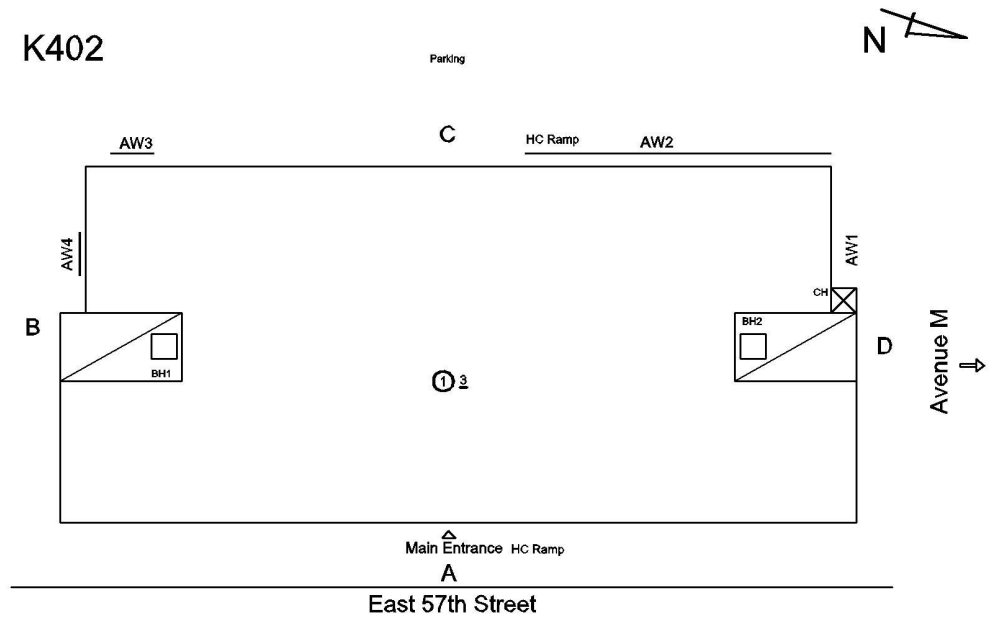

Inspection

Question	Response
Architectural	
EXTERIOR	Inspected
AREAWAY	Inspected
Instance on AW1-AW4	Inspected
Instance Condition	3 - Fair
Instance Quantity	4
Instance Quantity Uom	EACH
Deficiency	AREAWAY WALLS: DETERIORATED COPING STONE
Roof Plan reference	K402
Deficiency Quantity	20
Quantity Uom	S.F.
Potential Action	REPAIR
Urgency of Action	PRIORITY 3
Purpose of Action	LEVEL 2

**NYC Department of Education
Building Condition Assessment Survey 2023 - 2024**

Architectural Inspection

K402

Question

Response

EXTERIOR

AREAWAY

Deficiency Photo1



AW2


Violations

No violations recorded.

Deficiency

**AREAWAY STAIRS: DETERIORATED
TREADS/RISERS/NOSINGS**

Roof Plan reference

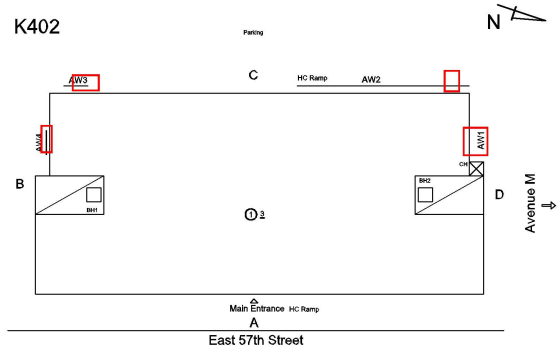

Deficiency Quantity

70

Quantity Uom

S.F.

Potential Action

REPAIR

Urgency of Action

PRIORITY 3

Purpose of Action

LEVEL 2

Deficiency Photo1



AW2

Violations

No violations recorded.

Deficiency

AREAWAY WALLS: CRACKS AND SPALLING

**NYC Department of Education
Building Condition Assessment Survey 2023 - 2024**

Architectural Inspection

K402


Question

Response

EXTERIOR


AREAWAY

Roof Plan reference

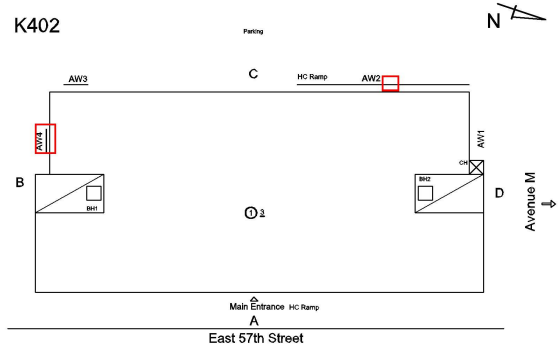

Deficiency Quantity
Quantity Uom
Potential Action
Urgency of Action
Purpose of Action
Deficiency Photo1

25
S.F.
REPLACE
PRIORITY 4
LEVEL 2

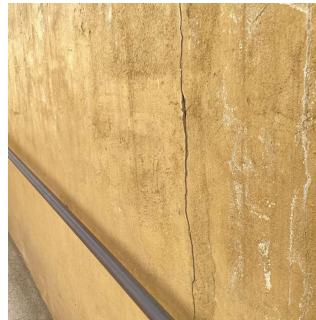


Violations

AW2
No violations recorded.

Deficiency

AREAWAY WALLS: CRACKS AND SPALLING

Roof Plan reference

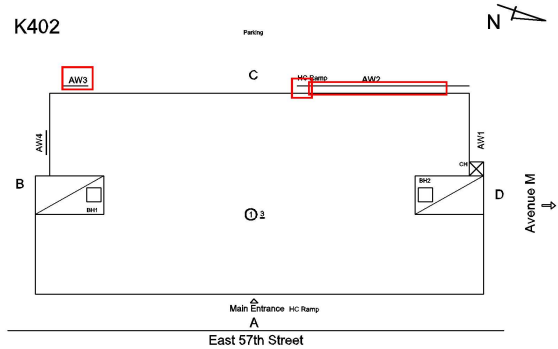


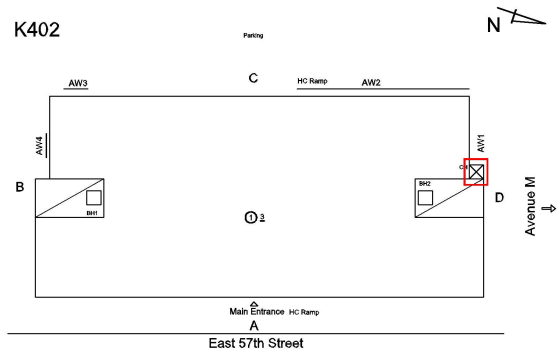

Deficiency Quantity
Quantity Uom
Potential Action
Urgency of Action
Purpose of Action

45
S.F.
REPAIR
PRIORITY 3
LEVEL 2

**NYC Department of Education
Building Condition Assessment Survey 2023 - 2024**

Architectural Inspection



K402

Question	Response
EXTERIOR	
AREAWAY	
Deficiency Photo1	
Violations	AW2 No violations recorded.
AWNINGS AND CANOPIES	
Condition	Inspected 2 - Between Good and Fair
Deficiency	No deficiencies recorded
CHIMNEY	
Material Type(s)	Inspected Masonry
Condition	3 - Fair
Deficiency	BRICK: DETERIORATED JOINTS
Roof Plan reference	<p>K402</p>  <p>East 57th Street</p>
Deficiency Quantity	10
Quantity Uom	S.F.
Potential Action	REPOINT
Urgency of Action	PRIORITY 4
Purpose of Action	LEVEL 2
Deficiency Photo1	
Violations	CH No violations recorded.
Deficiency	BRICK: DETERIORATED JOINTS

**NYC Department of Education
Building Condition Assessment Survey 2023 - 2024**

Architectural Inspection

K402

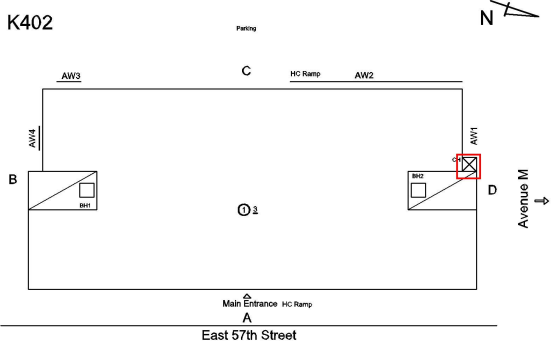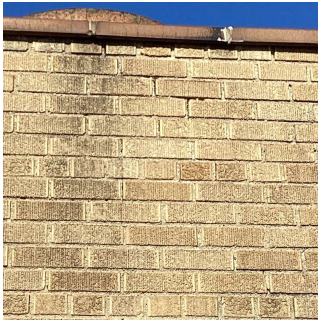Question	Response
EXTERIOR	
CHIMNEY	
Roof Plan reference	
Deficiency Quantity	15
Quantity Uom	S.F.
Potential Action	REPOINT
Urgency of Action	PRIORITY 3
Purpose of Action	LEVEL 2
Deficiency Photo1	
Violations	CH No violations recorded.
COPING	Not Required
CORNICE	Does not Exist
DOORS	Inspected
DOORS AND FRAMES	Inspected
Condition	2 - Between Good and Fair
Deficiency	No deficiencies recorded
DOOR HARDWARE	Inspected
Condition	2 - Between Good and Fair
Deficiency	No deficiencies recorded
LINTELS	Inspected
Condition	2 - Between Good and Fair
Deficiency	No deficiencies recorded
TRANSOM/SIDE LIGHT	Does not Exist
EXTERIOR WALLS	Inspected
Material Type(s)	Concrete, Masonry
Replacement Quantity	4,400
Replacement Uom	S.F.
Instance on All Facades	Inspected
Instance Condition	4 - Between Fair and Poor
Instance Quantity	4,400
Instance Quantity Uom	S.F.

**NYC Department of Education
Building Condition Assessment Survey 2023 - 2024**

Architectural Inspection

K402

Question

Response


EXTERIOR

EXTERIOR WALLS


Deficiency

BRICK: CRACKS/DISPLACED/SPALLED BRICK AT BUILDING CORNERS

Roof Plan reference

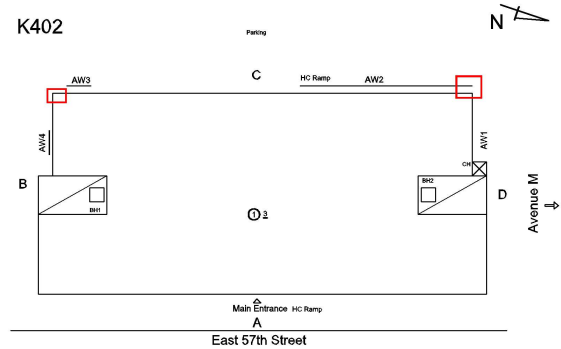

Elevation

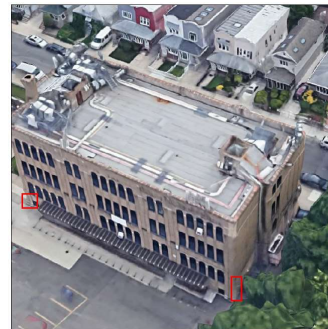

Deficiency Quantity

80

Quantity Uom

S.F.

Potential Action

REMOVE AND REBUILD

Urgency of Action

PRIORITY 4

Purpose of Action

LEVEL 2

Deficiency Photo1



Facade B


No violations recorded.

Violations

Deficiency

STONE: CHIPPED/SPALLED/BROKEN PIECES - MINOR

Roof Plan reference

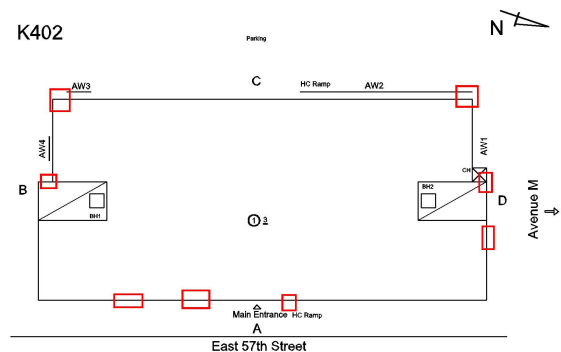

**NYC Department of Education
Building Condition Assessment Survey 2023 - 2024**

Architectural Inspection

K402

Question

Response

EXTERIOR

EXTERIOR WALLS

Elevation



Deficiency Quantity

150

Quantity Uom

S.F.

Potential Action

REPAIR

Urgency of Action

PRIORITY 3

Purpose of Action

LEVEL 2

Deficiency Photo1



Facade C

No violations recorded.


Violations

Deficiency


BRICK: DETERIORATED MASONRY SILLS - MINOR

Roof Plan reference

K402

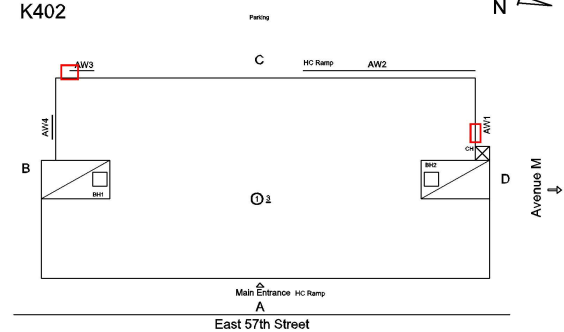

Elevation

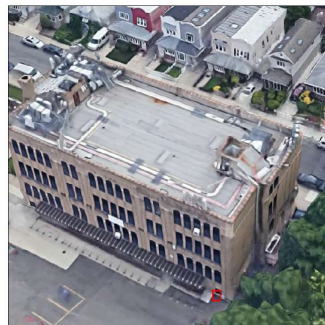

Deficiency Quantity

20

Quantity Uom

L.F.

Potential Action

REPAIR

**NYC Department of Education
Building Condition Assessment Survey 2023 - 2024**

Architectural Inspection

K402

Question

Response

EXTERIOR

EXTERIOR WALLS

Urgency of Action
Purpose of Action
Deficiency Photo1

PRIORITY 3
LEVEL 2



Facade C

Violations


No violations recorded.

Deficiency


STUCCO CEMENT SURFACE: CRACKS, SPALLING

Roof Plan reference

K402

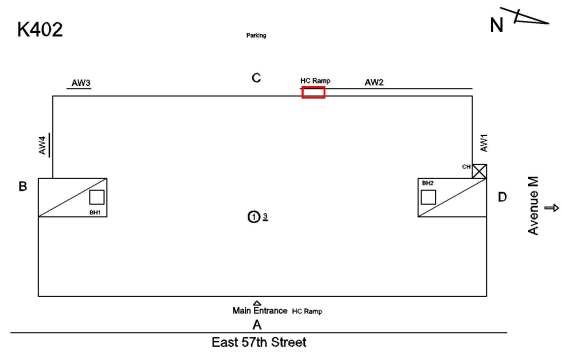

Elevation

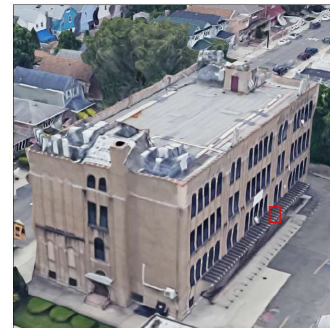

Deficiency Quantity

20

Quantity Uom

S.F.

Potential Action

REPLACE


Urgency of Action

PRIORITY 4

Purpose of Action

LEVEL 2

Deficiency Photo1


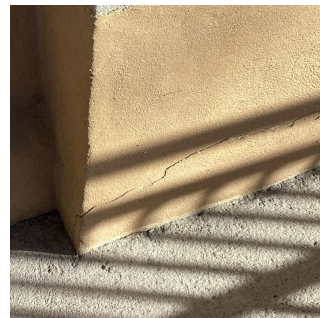



Facade C

**NYC Department of Education
Building Condition Assessment Survey 2023 - 2024**

Architectural Inspection

K402

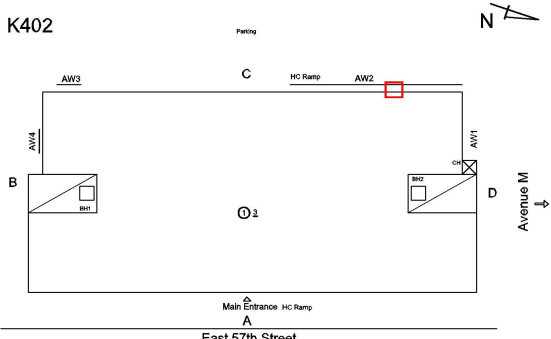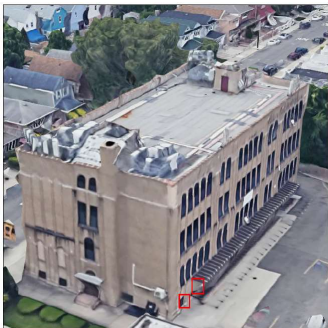Question	Response
EXTERIOR	
EXTERIOR WALLS	Inspected
Violations	No violations recorded.
EXTERIOR SOFFITS	Does not Exist
LOADING DOCK	Does not Exist
LOUVER	Inspected
Condition	3 - Fair
Deficiency	BROKEN/ DENTED BLADES
Roof Plan reference	<p>K402</p> 
Elevation	
Deficiency Quantity	60
Quantity Uom	S.F.
Potential Action	REPLACE
Urgency of Action	PRIORITY 4
Purpose of Action	LEVEL 2
Deficiency Photo1	
Violations	<p>Facade C</p> <p>No violations recorded.</p>
PARAPETS	Not Required
PLAZA DECK	Does not Exist
ROOF	Not Required
STAIRS/RAMPS: EXTERIOR	Inspected
BUILDING CHEEK/FLANK WALLS	Inspected
Condition	3 - Fair

NYC Department of Education
Building Condition Assessment Survey 2023 - 2024

Architectural Inspection

K402

Question	Response
----------	----------


EXTERIOR

STAIRS/RAMPS: EXTERIOR

BUILDING CHEEK/FLANK WALLS


Deficiency
 Roof Plan reference

BRICK: CRACKS/SPALLING - MINOR

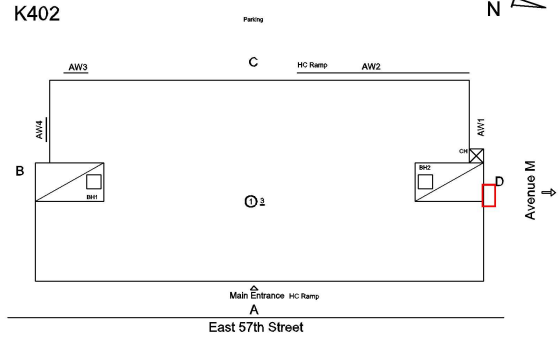

Deficiency Quantity
 Quantity Uom
 Potential Action
 Urgency of Action
 Purpose of Action
 Deficiency Photo1

20
 S.F.
 REPAIR
 PRIORITY 3
 LEVEL 2

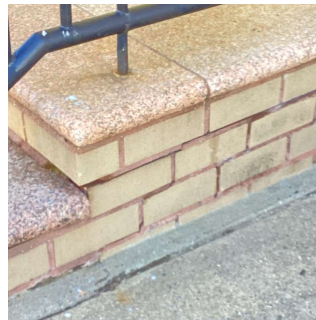

Facade D

Violations

No violations recorded.

RAILINGS


Condition
 Deficiency

Inspected
 2 - Between Good and Fair
 No deficiencies recorded

STAIRS/RAMPS

Condition
 Deficiency
 Roof Plan reference

Inspected
 4 - Between Fair and Poor
CONCRETE: CRACKS/SPALLING - MAJOR

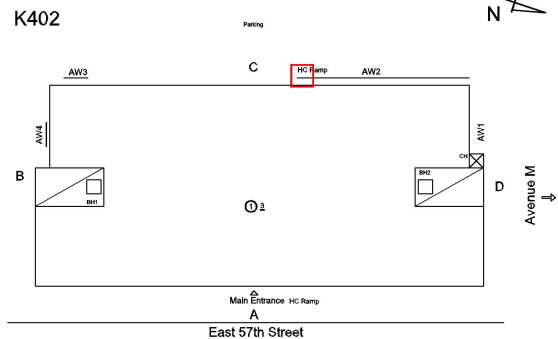

Deficiency Quantity
 Quantity Uom
 Potential Action
 Urgency of Action
 Purpose of Action

20
 S.F.
 REPLACE
 PRIORITY 4
 LEVEL 2

**NYC Department of Education
Building Condition Assessment Survey 2023 - 2024**

Architectural Inspection

K402

Question	Response
----------	----------

EXTERIOR

STAIRS/RAMPS: EXTERIOR

STAIRS/RAMPS

Deficiency Photo1



Facade C

No violations recorded.

Violations

WINDOWS

Inspected

Replacement Quantity

600

Replacement Uom

S.F.

EXTERIOR GUARDS

Inspected

Condition


3 - Fair

Deficiency


DETERIORATED/TORN-OUT/MISSING

Roof Plan reference

K402

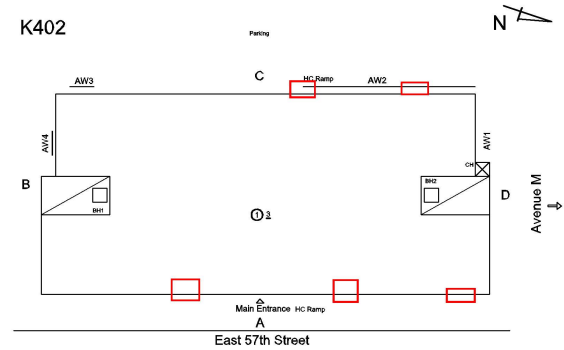

Elevation

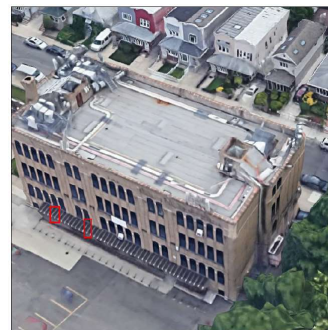

Deficiency Quantity

150

Quantity Uom

S.F.

Potential Action

REPLACE

Urgency of Action

PRIORITY 4


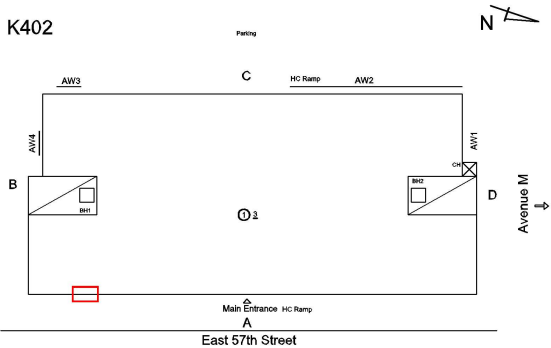
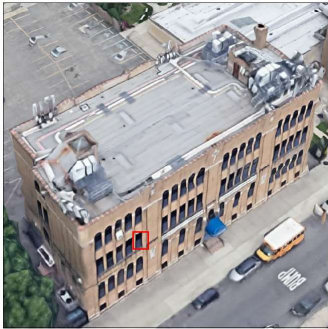
Purpose of Action

LEVEL 2

**NYC Department of Education
Building Condition Assessment Survey 2023 - 2024**

Architectural Inspection

K402

Question	Response
EXTERIOR	
WINDOWS	
EXTERIOR GUARDS	
Deficiency Photo1	
Violations	Facade C No violations recorded.
LINTELS	Inspected
Condition	2 - Between Good and Fair
Deficiency	No deficiencies recorded
WINDOWS	Inspected
Material Type(s)	Aluminum
Instance on Aluminum - Double Hung: All Facades	Inspected
Instance Condition	5 - Poor
Instance Quantity	600
Instance Quantity Uom	S.F.
Are these windows insulated	Yes
Installation Year	2000
Source of Installation	Custodial Staff
Deficiency	ALUMINUM - DOUBLE HUNG: BROKEN PANE
Roof Plan reference	K402 
Elevation	
Deficiency Quantity	30
Quantity Uom	S.F.
Potential Action	MAINTENANCE
Urgency of Action	PRIORITY 3

**NYC Department of Education
Building Condition Assessment Survey 2023 - 2024**

Architectural Inspection

K402

Question

Response


EXTERIOR

WINDOWS

WINDOWS

Purpose of Action
Deficiency Photo1

LEVEL 2

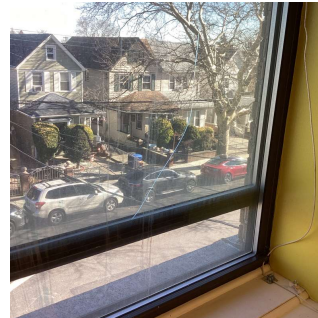

Facade A - Room 201

Violations


No violations recorded.

Deficiency


ALUMINUM - DOUBLE HUNG: AIR/WATER INFILTRATION

Roof Plan reference

K402

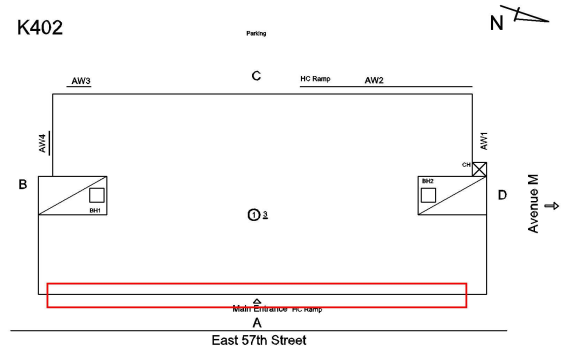

Elevation

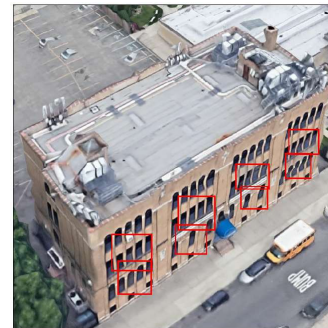

Deficiency Quantity

200

Quantity Uom

L.F.

Potential Action

REPLACE TRIM, SILLS OR WEATHERSTRIPPING


Urgency of Action

PRIORITY 5

Purpose of Action

LEVEL 2


Deficiency Photo1

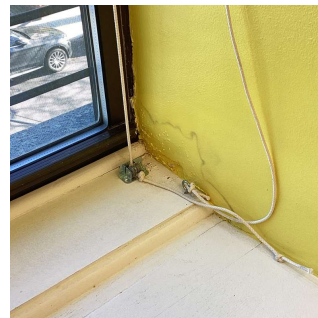

NYC Department of Education
Building Condition Assessment Survey 2023 - 2024

Architectural Inspection

K402

Question	Response
EXTERIOR	Inspected
WINDOWS	Inspected
WINDOWS	
Violations	Facade A - Room 201 (Facade A - Rooms 101, 105, 107, 109, 203, 205, 207 similar) No violations recorded.
INTERIOR	Inspected
POOLS	Does not Exist
STRUCTURAL	Inspected
COLUMNS/BEAMS/BEARING WALLS	Inspected
Condition	2 - Between Good and Fair
Deficiency	No deficiencies recorded
FLOOR STRUCTURE	Inspected
Condition	3 - Fair
Deficiency	CONCRETE SLAB ON GRADE: THRU CRACKS
Deficiency Location/Instance	Basement
Deficiency Quantity	60
Quantity Uom	S.F.
Potential Action	REPAIR
Urgency of Action	PRIORITY 3
Purpose of Action	LEVEL 5
Deficiency Photo1	
Violations	Boiler Room (Electrical Panel Room similar) No violations recorded.
FOUNDATION WALLS	Inspected
Material Type(s)	Concrete, Masonry
Condition	3 - Fair
Deficiency	CONCRETE: CRACKED/SPALLED/REINFORCEMENT EXPOSED
Deficiency Location/Instance	Basement
Deficiency Quantity	25
Quantity Uom	S.F.
Potential Action	REPAIR
Urgency of Action	PRIORITY 3
Purpose of Action	LEVEL 5

NYC Department of Education
Building Condition Assessment Survey 2023 - 2024

Architectural Inspection



K402

Question	Response
INTERIOR	Inspected
STRUCTURAL	
FOUNDATION WALLS	
Deficiency Photo1	
Violations	Boiler Room No violations recorded.
ROOF STRUCTURE	Not Required
VAULTS-BUNKERS	Does not Exist
AUDITORIUM	Does not Exist
CAFETERIA	Does not Exist
CLASSROOMS/CORRIDORS/ADMIN SPACES	Inspected
Ceiling	Inspected
Condition	2 - Between Good and Fair
Deficiency	PLASTER: CRACKS/SPALLING - ACTIVE LEAK
Deficiency Location/Instance	Room 203
Deficiency Quantity	15
Quantity Uom	S.F.
Potential Action	REPLACE
Urgency of Action	PRIORITY 5
Purpose of Action	LEVEL 2
Deficiency Photo1	
Violations	Room 203 No violations recorded.
Door(s)	Inspected
Condition	5 - Poor
Deficiency	WOOD: DETERIORATED DOOR
Deficiency Location/Instance	Rooms 106, 109, 202, 203, 207 and others
Deficiency Quantity	7
Quantity Uom	EACH
Potential Action	MAINTENANCE
Urgency of Action	PRIORITY 3
Purpose of Action	LEVEL 2

**NYC Department of Education
Building Condition Assessment Survey 2023 - 2024**

Architectural Inspection


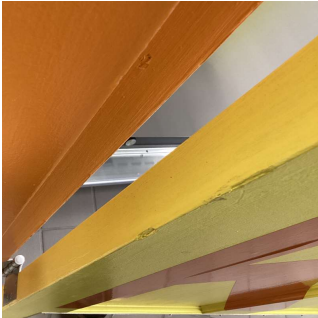
K402

Question	Response
INTERIOR	
CLASSROOMS/CORRIDORS/ADMIN SPACES	
Door(s)	
Deficiency Photo1	
Violations	Room 207 No violations recorded.
Floor Finish	Inspected
Condition	2 - Between Good and Fair
Deficiency	No deficiencies recorded
Walls	Inspected
Condition	2 - Between Good and Fair
Deficiency	PLASTER: CRACKS/SPALLING - ACTIVE LEAK
Deficiency Location/Instance	Rooms 101, 105, 107, 109, 201, 205, 207
Deficiency Quantity	100
Quantity Uom	S.F.
Potential Action	REPLACE
Urgency of Action	PRIORITY 5
Purpose of Action	LEVEL 2
Deficiency Photo1	
Violations	Room 207 No violations recorded.
Specialties	Does not Exist
GYMNASIUM	Does not Exist
INTERIOR DOOR HARDWARE	Inspected
Condition	2 - Between Good and Fair
Deficiency	No deficiencies recorded
INTERIOR GUARDS	Inspected
Condition	2 - Between Good and Fair
Deficiency	DETERIORATED/TORN-OUT/MISSING
Deficiency Location/Instance	Stair A/Basement
Deficiency Quantity	20
Quantity Uom	S.F.
Potential Action	REPLACE
Urgency of Action	PRIORITY 3

**NYC Department of Education
Building Condition Assessment Survey 2023 - 2024**

Architectural Inspection


K402

Question	Response
INTERIOR	
INTERIOR GUARDS	
Purpose of Action	LEVEL 2
Deficiency Photo1	
Violations	Stair A/Basement No violations recorded.
KITCHEN	Inspected
Instance on 2nd Floor	Inspected
Instance on 1st Floor	Inspected
Instance on Basement	Inspected
Ceiling	
Instance on Basement	Inspected
Condition	1 - Good
Deficiency	No deficiencies recorded
Instance on 2nd Floor	Inspected
Condition	1 - Good
Deficiency	No deficiencies recorded
Instance on 1st Floor	Inspected
Condition	1 - Good
Deficiency	No deficiencies recorded
Door(s)	
Instance on 1st Floor	Inspected
Condition	3 - Fair
Deficiency	WOOD: DETERIORATED DOOR
Deficiency Location/Instance	Entrance
Deficiency Quantity	1
Quantity Uom	EACH
Potential Action	MAINTENANCE
Urgency of Action	PRIORITY 3
Purpose of Action	LEVEL 2
Deficiency Photo1	
Violations	Entrance No violations recorded.
Instance on 2nd Floor	Inspected

**NYC Department of Education
Building Condition Assessment Survey 2023 - 2024**

Architectural Inspection

K402

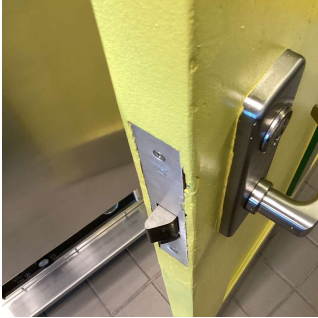Question	Response
INTERIOR	
KITCHEN	
Door(s)	
Condition	3 - Fair
Deficiency	WOOD: DETERIORATED DOOR
Deficiency Location/Instance	Entrance
Deficiency Quantity	1
Quantity Uom	EACH
Potential Action	MAINTENANCE
Urgency of Action	PRIORITY 3
Purpose of Action	LEVEL 2
Deficiency Photo1	
Violations	Entrance No violations recorded.
Floor Finish	
Instance on 2nd Floor	Inspected
Condition	1 - Good
Deficiency	No deficiencies recorded
Instance on 1st Floor	Inspected
Condition	1 - Good
Deficiency	No deficiencies recorded
Instance on Basement	Inspected
Condition	1 - Good
Deficiency	No deficiencies recorded
Walls	
Instance on 1st Floor	Inspected
Condition	2 - Between Good and Fair
Deficiency	PLASTER: CRACKS/SPALLING
Deficiency Location/Instance	Along Window
Deficiency Quantity	15
Quantity Uom	S.F.
Potential Action	REPLACE
Urgency of Action	PRIORITY 3
Purpose of Action	LEVEL 2

**NYC Department of Education
Building Condition Assessment Survey 2023 - 2024**

Architectural Inspection


K402

Question	Response
INTERIOR	
KITCHEN	Inspected
Walls	
Deficiency Photo1	
Violations	Along Window No violations recorded.
LIBRARY	Does not Exist
LOCKER ROOM	Does not Exist
MULTI-PURPOSE ROOM	Inspected
Instance on Basement	Inspected
Ceiling	
Instance on Basement	Inspected
Condition	1 - Good
Deficiency	No deficiencies recorded
Door(s)	
Instance on Basement	Inspected
Condition	1 - Good
Deficiency	No deficiencies recorded
Fixed Equipment	
Instance on Basement	Does not Exist
Floor Finish	
Instance on Basement	Inspected
Condition	1 - Good
Deficiency	No deficiencies recorded
Sliding-folding Partition	
Instance on Basement	Does not Exist
Stage	
Instance on Basement	Does not Exist
Walls	
Instance on Basement	Inspected
Condition	1 - Good
Deficiency	No deficiencies recorded
Window Curtains/Shades/Blinds	
Instance on Basement	Does not Exist
SCIENCE DEMO ROOM	Does not Exist
SCIENCE LAB	Does not Exist
SCIENCE PREP ROOM	Does not Exist
SHOWER ROOM	Does not Exist
STAIRS/RAMPS: INTERIOR	Inspected
Do Letter Stair Signs Exist?	Yes
Ceiling	Inspected

NYC Department of Education
Building Condition Assessment Survey 2023 - 2024

Architectural Inspection

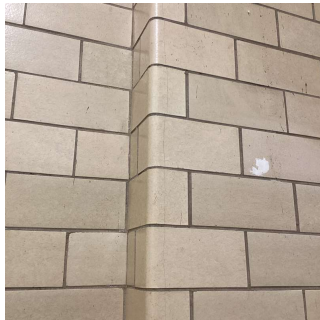

K402

Question	Response
INTERIOR	
STAIRS/RAMPS: INTERIOR	
Ceiling	Inspected
Condition	2 - Between Good and Fair
Deficiency	No deficiencies recorded
Door(s)	Inspected
Condition	2 - Between Good and Fair
Deficiency	No deficiencies recorded
Partition	Does not Exist
Railings	Inspected
Condition	2 - Between Good and Fair
Deficiency	No deficiencies recorded
Stairs and Landings	Inspected
Condition	2 - Between Good and Fair
Deficiency	No deficiencies recorded
Walls	Inspected
Condition	2 - Between Good and Fair
Deficiency	GLAZED BLOCK: CRACKS/SPALLING
Deficiency Location/Instance	Stair A/1
Deficiency Quantity	10
Quantity Uom	S.F.
Potential Action	REPLACE
Urgency of Action	PRIORITY 3
Purpose of Action	LEVEL 2
Deficiency Photo1	
Violations	Stair A/1 No violations recorded.
Deficiency	PLASTER: CRACKS/SPALLING
Deficiency Location/Instance	Stair A/1
Deficiency Quantity	10
Quantity Uom	S.F.
Potential Action	REPLACE
Urgency of Action	PRIORITY 3
Purpose of Action	LEVEL 2

**NYC Department of Education
Building Condition Assessment Survey 2023 - 2024**

Architectural Inspection



K402

Question	Response
INTERIOR	
STAIRS/RAMPS: INTERIOR	Inspected
Walls	
Deficiency Photo1	
Violations	Stair A/1 No violations recorded.
TOILET ROOMS - STAFF	Inspected
Ceiling	Inspected
Condition	1 - Good
Deficiency	No deficiencies recorded
Door(s)	Inspected
Condition	1 - Good
Deficiency	No deficiencies recorded
Floor Finish	Inspected
Condition	1 - Good
Deficiency	No deficiencies recorded
Stalls	Does not Exist
Walls	Inspected
Condition	1 - Good
Deficiency	No deficiencies recorded
TOILET ROOMS - STUDENTS	Inspected
Ceiling	Inspected
Condition	1 - Good
Deficiency	No deficiencies recorded
Door(s)	Inspected
Condition	5 - Poor
Deficiency	WOOD: DETERIORATED DOOR
Deficiency Location/Instance	Rooms 202A,208A, B09
Deficiency Quantity	3
Quantity Uom	EACH
Potential Action	MAINTENANCE
Urgency of Action	PRIORITY 3
Purpose of Action	LEVEL 2
Deficiency Photo1	

**NYC Department of Education
Building Condition Assessment Survey 2023 - 2024**

Architectural Inspection

K402

Question	Response
INTERIOR	
TOILET ROOMS - STUDENTS	
Door(s)	
Violations	Room 202A No violations recorded.
Deficiency	WOOD: DETERIORATED DOOR AND FRAME
Deficiency Location/Instance	Room B08
Deficiency Quantity	1
Quantity Uom	EACH
Potential Action	MAINTENANCE
Urgency of Action	PRIORITY 3
Purpose of Action	LEVEL 2
Deficiency Photo1	
Violations	Room B08 No violations recorded.
Floor Finish	Inspected
Condition	1 - Good
Deficiency	No deficiencies recorded
Stalls	Inspected
Condition	5 - Poor
Deficiency	RUST - MAJOR
Deficiency Location/Instance	Room 202A
Deficiency Quantity	4
Quantity Uom	EACH
Potential Action	REPLACE
Urgency of Action	PRIORITY 3
Purpose of Action	LEVEL 2
Deficiency Photo1	
Violations	Room 202A No violations recorded.
Walls	Inspected
Condition	2 - Between Good and Fair
Deficiency	No deficiencies recorded
LIFE SAFETY	Inspected

NYC Department of Education
Building Condition Assessment Survey 2023 - 2024

Architectural Inspection

K402

Question	Response
LIFE SAFETY	Inspected
F.D. HOLDING AREA	Does not Exist
STEEL STAIRS	Does not Exist
SITE	Does not Exist
ARTWORK	Does not Exist