

NYC Department of Education
Building Condition Assessment Survey 2023 - 2024

Architectural Inspection

K684

Asset: P.S. 188 GYM - BROOKLYN, 2815 WEST 35 STREET, New York, 11224

Inspection Id	Inspection Type	Time In	Last Edited
SA : K684	Architectural - Senior	2024-05-16 8:09 AM	2024-05-21 3:50 PM
AA : K684	Architectural - Associate	2024-05-16 12:17 PM	2024-05-21 8:46 PM

Asset Data

Question	Answer
Was the building fully accessible for inspection	Yes
Building Square Footage	7,000
Comments on the Area (for Athletic Field, Playing Surfaces, Leased Spaces)	None
Comments on the Stories (Floors) plus Basements	1 (No Basement)
Comments on the Number of Classrooms	0
Comments on the Year Built	2012
Student Population	259
Staff Population	2
Weather	Fair
Principal(s) Information	

Principal Name	Leslie King
Organization	P. S. 168 - Brooklyn
Did you meet with this Principal?	Yes
Did this Principal provide feedback?	Yes
Summary of Principal's Feedback	The Principal had no comments regarding the physical condition of the building at this time.

Custodian	Efrain Cordero
Fireman	Patrick Calcagno
Facade Photo	




West 35th Street - Southeast View

**NYC Department of Education
Building Condition Assessment Survey 2023 - 2024**

Architectural Inspection

K684

Main Entrance Photo

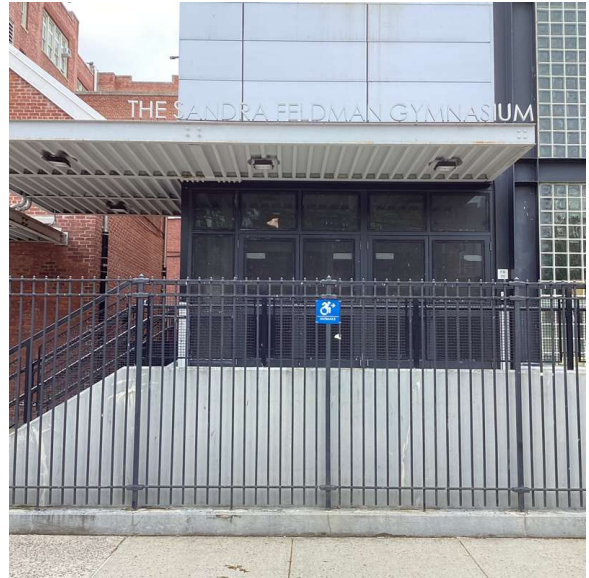

Facade A - West 35th Street


Roof Photo



Roof 1 - South View

Have any Systems/Major Building Components been upgraded? No
 Have there been any Building Additions? No
 Tandem Schools? No
 Leased Space? No

Priority Condition

Priority Condition Exist Last Year?	Priority Category	Condition Description	Component Affected	Location Description	Person(s) Notified	Person(s) Title	PhotoImage
No	Tripping Hazard	Severe damaged wood floor is a potential tripping hazard.	INTERIOR GYMNASIUM Floor Finish	Near Room 105	Patrick Calcagno	Fireman	

Structural Engineer Required

NYC Department of Education
Building Condition Assessment Survey 2023 - 2024

Architectural Inspection

K684

Structural Condition Type	Condition Description	Component Affected	Location Description	Person(s) Notified	Person(s) Title	PhotoImage
No condition recorded						

Programmatic Accessibility

Programmatic Accessibility Status Question	Response
Is the primary or secondary entrance on an accessible route?	Yes
Is the building a multi-story building?	No
Do any of the following spaces exist? Classroom, Art Room, Auditorium, Cafeteria, Computer, Gymnasiums, Library, Multipurpose Room, Science Labs	Yes
For the spaces that do exist, are they ALL accessible?	Yes
Is there at least one Boys and Girls or Unisex toilet accessible in the building	Yes

Physical Breakdown Structure	Exists	Required	Complies	Deficiency	Assistive Listening System	Fire Alarm Strobe
------------------------------	--------	----------	----------	------------	----------------------------	-------------------

PROGRAMMATIC ACCESSIBILITY

Exterior Routes

Exterior Entrances & Exits				Yes		
Exterior H/C Lifts	No	No				
Exterior Ramps and Railings	Yes		Yes			

Interior Routes

Corridor and Lobby H/C Lifts	No	No				
Interior Corridor Doors and Hardware	No	No				
Interior Corridors and Lobbies			Yes			
Interior Elevators	No					
Interior Lobby Doors and Hardware			Yes			
Interior Ramps	No					

Rooms & Spaces


Art Rooms		No				
Auditorium		No				
Cafeteria		No				
Classrooms		No				
Computer Rooms		No				
Gymnasium	1st Floor	Yes		Yes		FM System Yes
Library		No				
Main Office		No				
Multi-purpose Room		No				
Nurse's Room		No				
Pool		No				
Science Lab		No				
Toilet Rooms (Boys)	1st Floor	Yes		Yes		
Toilet Rooms (Girls)	1st Floor	Yes		Yes		
Toilet Rooms (Staff)	1st Floor	Yes		Yes		

NYC Department of Education
Building Condition Assessment Survey 2023 - 2024

Architectural Inspection

K684

Building Template

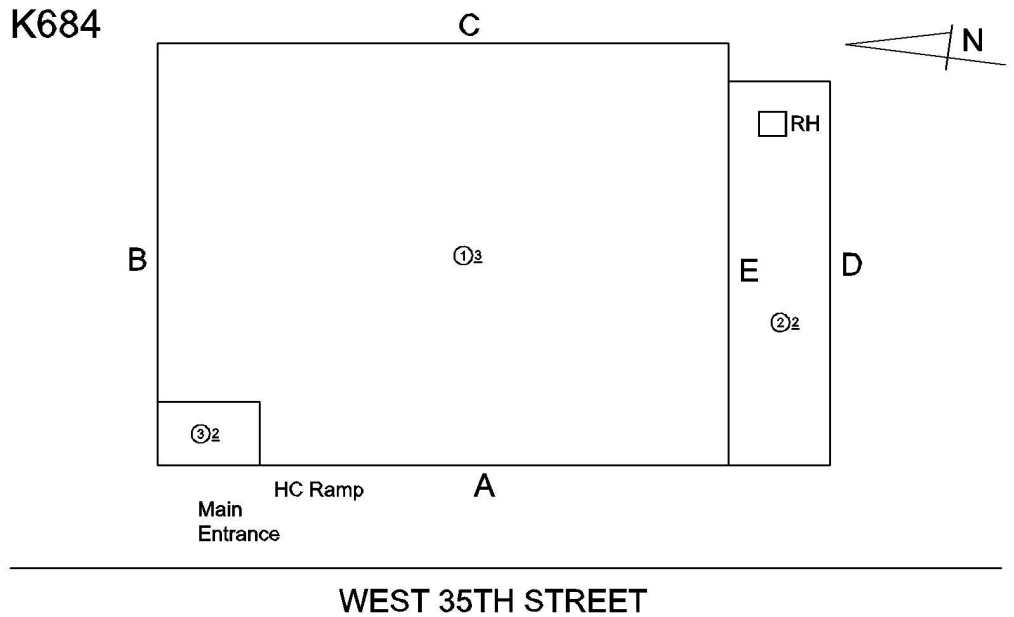


Inspection

Question	Response
Architectural	
EXTERIOR	Inspected
AREAWAY	Does not Exist
AWNINGS AND CANOPIES	Inspected
Condition	2 - Between Good and Fair
Deficiency	No deficiencies recorded
CHIMNEY	Does not Exist
COPING	Inspected
Condition	2 - Between Good and Fair
Deficiency	No deficiencies recorded
CORNICE	Does not Exist
DOORS	Inspected
DOORS AND FRAMES	Inspected
Condition	2 - Between Good and Fair
Deficiency	No deficiencies recorded
DOOR HARDWARE	Inspected
Condition	2 - Between Good and Fair
Deficiency	No deficiencies recorded
LINTELS	Inspected
Condition	2 - Between Good and Fair
Deficiency	No deficiencies recorded
TRANSOM/SIDE LIGHT	Inspected
Condition	2 - Between Good and Fair
Deficiency	No deficiencies recorded
EXTERIOR WALLS	Inspected
Material Type(s)	Masonry, Steel
Replacement Quantity	11,000
Replacement Uom	S.F.
Instance on All Facades	Inspected
Instance Condition	2 - Between Good and Fair

NYC Department of Education
Building Condition Assessment Survey 2023 - 2024

Architectural Inspection

K684

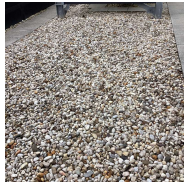Question	Response
EXTERIOR	
EXTERIOR WALLS	
Instance Quantity	11,000
Instance Quantity Uom	S.F.
Deficiency	No deficiencies recorded
EXTERIOR SOFFITS	Does not Exist
LOADING DOCK	Does not Exist
LOUVER	Does not Exist
PARAPETS	Inspected
Material Type(s)	Masonry, Metal
Replacement Quantity	2,000
Replacement Uom	C.F.
Instance on All Facades	Inspected
Instance Condition	2 - Between Good and Fair
Instance Quantity	2,000
Instance Quantity Uom	C.F.
Deficiency	No deficiencies recorded
PLAZA DECK	Does not Exist
ROOF	Inspected
Roofing	Inspected
Replacement Quantity	7,000
Replacement Uom	S.F.
ROOF HATCH/SMOKE HATCH	Inspected
Condition	2 - Between Good and Fair
Deficiency	No deficiencies recorded
LEADERS, GUTTERS, DOWNSPOUTS, SCUPPERS	Does not Exist
ROOF BARRIER/FENCE	Inspected
Condition	2 - Between Good and Fair
Deficiency	No deficiencies recorded
ROOF CAGE	Does not Exist
ROOFING	Inspected
Instance on IRMA: All Roofs	Inspected
Instance Condition	4 - Between Fair and Poor
Instance Photo	
	Roof 2
Instance Quantity	7,000
Instance Quantity Uom	S.F.
Does the roof have major mechanical equipment sitting on Dunnage Steel less than 18" above the Roofing?	No
Does this roof instance have a Sustainable Roof System?	No
Do solar panels exist on these roofs?	No
Is/Are the roof(s) suitable for Solar Panel installation?	No
Installation Year	2012
Source of Installation	Custodial Staff

**NYC Department of Education
Building Condition Assessment Survey 2023 - 2024**

Architectural Inspection

K684

Question	Response
----------	----------

EXTERIOR

ROOF


Roofing

ROOFING

Deficiency

IRMA: ROOFING: MAJOR ACTIVE ROOF LEAKS IN INSTRUCTIONAL SPACE

Roof Plan reference

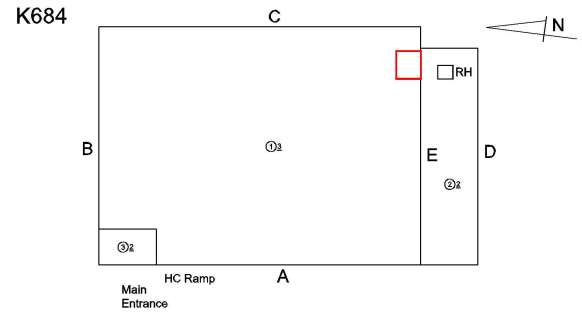

WEST 35TH STREET

Deficiency Quantity

100

Quantity Uom

S.F.

Potential Action

REPLACE ROOFING WITHOUT MAJOR EQUIPMENT REMOVAL


Urgency of Action

PRIORITY 5

Purpose of Action

LEVEL 2

Deficiency Photo1

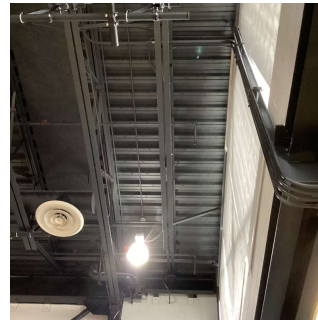

Roof 1 - Gymnasium

Violations

No violations recorded.

ROOFING DRAINS

Inspected


Condition

3 - Fair

Deficiency

DETERIORATED

Roof Plan reference

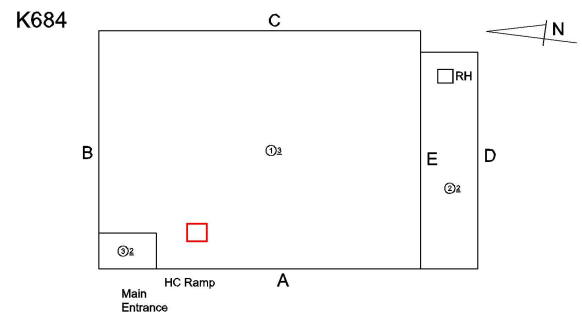

WEST 35TH STREET


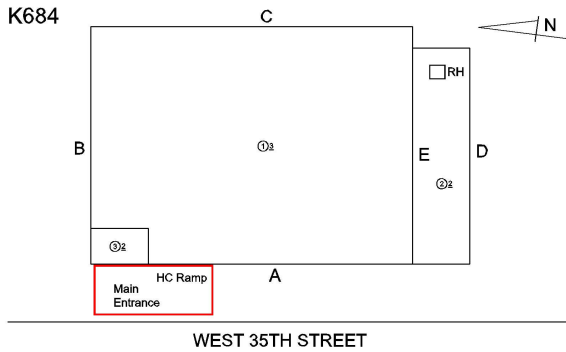
Deficiency Quantity

1

**NYC Department of Education
Building Condition Assessment Survey 2023 - 2024**

Architectural Inspection

K684

Question	Response
EXTERIOR	
ROOF	
Roofing	
ROOFING DRAINS	
Quantity Uom	EACH
Potential Action	REPLACE
Urgency of Action	PRIORITY 4
Purpose of Action	LEVEL 2
Deficiency Photo1	
Violations	Roof 1 No violations recorded.
Specialties	Inspected
BULKHEAD/PENTHOUSE	Does not Exist
CUPOLA/ SPIRES/ TOWERS	Does not Exist
DORMER	Does not Exist
DUNNAGE STEEL	Inspected
Condition	2 - Between Good and Fair
Deficiency	No deficiencies recorded
SKYLIGHT/ROOF VENT	Does not Exist
ROOF/GRAVITY TANK	Does not Exist
STAIRS/RAMPS: EXTERIOR	Inspected
BUILDING CHEEK/FLANK WALLS	Inspected
Condition	5 - Poor
Deficiency	CAST IN PLACE CONCRETE: CRACKS/SPALLING - MINOR
Roof Plan reference	K684 
Deficiency Quantity	100
Quantity Uom	S.F.
Potential Action	REPAIR
Urgency of Action	PRIORITY 3
Purpose of Action	LEVEL 2

**NYC Department of Education
Building Condition Assessment Survey 2023 - 2024**

Architectural Inspection

K684

Question	Response
----------	----------

EXTERIOR

STAIRS/RAMPS: EXTERIOR

BUILDING CHEEK/FLANK WALLS

Deficiency Photo1



Facade A - HC Ramp


No violations recorded.

Violations

Deficiency

Roof Plan reference

CAST IN PLACE CONCRETE: CRACKS/SPALLING - MAJOR
K684

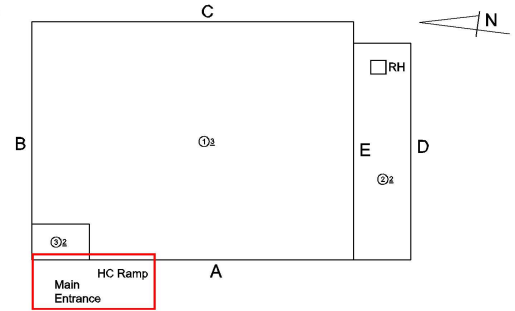

WEST 35TH STREET

Deficiency Quantity

60

Quantity Uom

S.F.

Potential Action

REPLACE

Urgency of Action

PRIORITY 4

Purpose of Action

LEVEL 2

Deficiency Photo1



Facade A - HC Ramp

No violations recorded.

Violations

RAILINGS

Inspected

Condition

2 - Between Good and Fair

Deficiency

No deficiencies recorded

STAIRS/RAMPS

Inspected

Condition

2 - Between Good and Fair

Deficiency

No deficiencies recorded

WINDOWS

Inspected

Replacement Quantity

30


Replacement Uom

S.F.

**NYC Department of Education
Building Condition Assessment Survey 2023 - 2024**

Architectural Inspection

K684

Question	Response
EXTERIOR	
WINDOWS	
EXTERIOR GUARDS	Inspected
Condition	2 - Between Good and Fair
Deficiency	No deficiencies recorded
LINTELS	Inspected
Condition	2 - Between Good and Fair
Deficiency	No deficiencies recorded
WINDOWS	Inspected
Material Type(s)	Aluminum
Instance on Aluminum - Double Hung: Facade A	Inspected
Instance Condition	2 - Between Good and Fair
Instance Quantity	30
Instance Quantity Uom	S.F.
Are these windows insulated	Yes
Installation Year	2012
Source of Installation	Custodial Staff
Deficiency	No deficiencies recorded
INTERIOR	Inspected
POOLS	Does not Exist
STRUCTURAL	Inspected
COLUMNS/BEAMS/BEARING WALLS	Inspected
Condition	2 - Between Good and Fair
Deficiency	No deficiencies recorded
FLOOR STRUCTURE	Inspected
Condition	2 - Between Good and Fair
Deficiency	No deficiencies recorded
FOUNDATION WALLS	Inspected
Material Type(s)	Concrete
Condition	3 - Fair
Deficiency	CONCRETE: CRACKED/SPALLED/REINFORCEMENT EXPOSED
Deficiency Location/Instance	Facades B, C, D
Deficiency Quantity	200
Quantity Uom	S.F.
Potential Action	REPAIR
Urgency of Action	PRIORITY 3
Purpose of Action	LEVEL 5
Deficiency Photo1	
Violations	Facade D No violations recorded.
ROOF STRUCTURE	Inspected

**NYC Department of Education
Building Condition Assessment Survey 2023 - 2024**

Architectural Inspection

K684

Question	Response
INTERIOR	
STRUCTURAL	Inspected
ROOF STRUCTURE	Inspected
Condition	2 - Between Good and Fair
Deficiency	No deficiencies recorded
VAULTS-BUNKERS	Does not Exist
AUDITORIUM	Does not Exist
CAFETERIA	Does not Exist
CLASSROOMS/CORRIDORS/ADMIN SPACES	Inspected
Ceiling	Inspected
Condition	2 - Between Good and Fair
Deficiency	GYPSUM BOARD: DAMAGED/DETERIORATED
Deficiency Location/Instance	Main Entrance
Deficiency Quantity	10
Quantity Uom	S.F.
Potential Action	REPLACE
Urgency of Action	PRIORITY 3
Purpose of Action	LEVEL 2
Deficiency Photo1	
Violations	No violations recorded.
Door(s)	Not Required
Floor Finish	Inspected
Condition	2 - Between Good and Fair
Deficiency	No deficiencies recorded
Walls	Inspected
Condition	2 - Between Good and Fair
Deficiency	No deficiencies recorded
Specialties	Does not Exist
GYMNASIUM	Inspected
Instance on 1st Floor	Inspected
Ceiling	
Instance on 1st Floor	Inspected
Condition	2 - Between Good and Fair
Deficiency	GYPSUM BOARD: DAMAGED/DETERIORATED
Deficiency Location/Instance	Office Room
Deficiency Quantity	10
Quantity Uom	S.F.
Potential Action	REPLACE
Urgency of Action	PRIORITY 3
Purpose of Action	LEVEL 2

**NYC Department of Education
Building Condition Assessment Survey 2023 - 2024**

Architectural Inspection

K684

Question	Response
INTERIOR	
GYMNASIUM	
Ceiling	
Deficiency Photo1	
	Office Room
Violations	No violations recorded.
Door(s)	
Instance on 1st Floor	Inspected
Condition	2 - Between Good and Fair
Deficiency	No deficiencies recorded
Fixed Equipment	
Instance on 1st Floor	Inspected
Condition	2 - Between Good and Fair
Deficiency	No deficiencies recorded
Floor Finish	
Instance on 1st Floor	Inspected
Condition	2 - Between Good and Fair
Deficiency	WOOD: DAMAGED/DETERIORATED
Deficiency Location/Instance	Near Room 105
Deficiency Quantity	20
Quantity Uom	S.F.
Potential Action	REPLACE
Urgency of Action	PRIORITY 5
Purpose of Action	LEVEL 6
Deficiency Photo1	
	Near Room 105
Violations	No violations recorded.
Seating	
Instance on 1st Floor	Inspected
Condition	2 - Between Good and Fair
Deficiency	No deficiencies recorded
Sliding-folding Partition	
Instance on 1st Floor	Inspected
Condition	2 - Between Good and Fair

NYC Department of Education
Building Condition Assessment Survey 2023 - 2024

Architectural Inspection

K684

Question	Response
INTERIOR	
GYMNASIUM	
Sliding-folding Partition	
Deficiency	No deficiencies recorded
Stage	
Instance on 1st Floor	Does not Exist
Walls	
Instance on 1st Floor	Inspected
Condition	2 - Between Good and Fair
Deficiency	No deficiencies recorded
Window Curtains/Shades/Blinds	
Instance on 1st Floor	Does not Exist
INTERIOR DOOR HARDWARE	
Condition	2 - Between Good and Fair
Deficiency	No deficiencies recorded
INTERIOR GUARDS	
Condition	Does not Exist
KITCHEN	
Condition	Does not Exist
LIBRARY	
Condition	Does not Exist
LOCKER ROOM	
Instance on 1st Floor - Boys	Inspected
Alternative use	No
Instance on 1st Floor - Girls	Inspected
Alternative use	No
Ceiling	
Instance on 1st Floor - Boys	Inspected
Condition	2 - Between Good and Fair
Deficiency	No deficiencies recorded
Instance on 1st Floor - Girls	Inspected
Condition	2 - Between Good and Fair
Deficiency	No deficiencies recorded
Door(s)	
Instance on 1st Floor - Girls	Inspected
Condition	2 - Between Good and Fair
Deficiency	No deficiencies recorded
Instance on 1st Floor - Boys	Inspected
Condition	2 - Between Good and Fair
Deficiency	No deficiencies recorded
Floor Finish	
Instance on 1st Floor - Boys	Inspected
Condition	2 - Between Good and Fair
Deficiency	No deficiencies recorded
Instance on 1st Floor - Girls	Inspected
Condition	2 - Between Good and Fair
Deficiency	No deficiencies recorded
Locker Room Lockers	
Instance on 1st Floor - Girls	Inspected
Condition	2 - Between Good and Fair
Deficiency	No deficiencies recorded
Instance on 1st Floor - Boys	Inspected
Condition	2 - Between Good and Fair

NYC Department of Education
Building Condition Assessment Survey 2023 - 2024

Architectural Inspection

K684

Question	Response
INTERIOR	
LOCKER ROOM	
Locker Room Lockers	
Deficiency	No deficiencies recorded
Walls	
Instance on 1st Floor - Girls	Inspected
Condition	2 - Between Good and Fair
Deficiency	No deficiencies recorded
Instance on 1st Floor - Boys	Inspected
Condition	2 - Between Good and Fair
Deficiency	No deficiencies recorded
MULTI-PURPOSE ROOM	Does not Exist
SCIENCE DEMO ROOM	Does not Exist
SCIENCE LAB	Does not Exist
SCIENCE PREP ROOM	Does not Exist
SHOWER ROOM	Does not Exist
STAIRS/RAMPS: INTERIOR	Does not Exist
TOILET ROOMS - STAFF	Inspected
Ceiling	Inspected
Condition	2 - Between Good and Fair
Deficiency	No deficiencies recorded
Door(s)	Inspected
Condition	2 - Between Good and Fair
Deficiency	No deficiencies recorded
Floor Finish	Inspected
Condition	2 - Between Good and Fair
Deficiency	No deficiencies recorded
Stalls	Does not Exist
Walls	Inspected
Condition	2 - Between Good and Fair
Deficiency	No deficiencies recorded
TOILET ROOMS - STUDENTS	Inspected
Ceiling	Inspected
Condition	2 - Between Good and Fair
Deficiency	No deficiencies recorded
Door(s)	Not Required
Floor Finish	Inspected
Condition	2 - Between Good and Fair
Deficiency	No deficiencies recorded
Stalls	Inspected
Condition	2 - Between Good and Fair
Deficiency	No deficiencies recorded
Walls	Inspected
Condition	2 - Between Good and Fair
Deficiency	No deficiencies recorded
LIFE SAFETY	Inspected
F.D. HOLDING AREA	Does not Exist
STEEL STAIRS	Does not Exist
SITE	Inspected

**NYC Department of Education
Building Condition Assessment Survey 2023 - 2024**

Architectural Inspection

K684

Question	Response
SITE	
CONTAINERIZATION	Does not Exist
Drainage System for Asphalt	Does not Exist
Drainage System for Concrete	Inspected
Catch Basins/Manhole - Surrounded by concrete	Inspected
Condition	2 - Between Good and Fair
Deficiency	No deficiencies recorded
Culverts - Concrete Covering	Does not Exist
Drainage System for Soil	Inspected
Catch Basins/Manhole - Surrounded by Soil	Inspected
Condition	2 - Between Good and Fair
Deficiency	No deficiencies recorded
Culverts - Soil Covering	Does not Exist
DRINKING FOUNTAINS	Does not Exist
FENCES	Inspected
Condition	3 - Fair
Deficiency	CONCRETE CURB: DAMAGED/DETERIORATED
Deficiency Location/Instance	West 33rd Street, Rear Side, Northeast Side of Building
Deficiency Quantity	80
Quantity Uom	S.F.
Potential Action	REPLACE
Urgency of Action	PRIORITY 3
Purpose of Action	LEVEL 2
Deficiency Photo1	
Violations	Northeast Side of Building No violations recorded.
IRRIGATION SYSTEM	Does not Exist
PAVING	Inspected
Student Non-Use	Inspected
Gravel Exists?	No
Asphalt	Does not Exist
Concrete	Inspected
Condition	2 - Between Good and Fair
Deficiency	No deficiencies recorded
Pavers	Does not Exist
Student Use	Does not Exist
Site Sidewalks & Walkways	Does not Exist
DOT Sidewalk	Inspected
Asphalt	Does not Exist
Concrete	Inspected
Condition	3 - Fair

**NYC Department of Education
Building Condition Assessment Survey 2023 - 2024**

Architectural Inspection

K684

Question	Response
SITE	
PAVING	
DOT Sidewalk	
Concrete	
Deficiency	DAMAGED CURBS
Deficiency Location/Instance	West 35th Street
Deficiency Quantity	30
Quantity Uom	L.F.
Potential Action	REPLACE
Urgency of Action	PRIORITY 3
Purpose of Action	LEVEL 2
Deficiency Photo1	
	West 35th Street
Violations	No violations recorded.
Deficiency	DAMAGED/DETERIORATED/MISSING SECTIONS
Deficiency Location/Instance	West 35th Street
Deficiency Quantity	75
Quantity Uom	S.F.
Potential Action	REPLACE
Urgency of Action	PRIORITY 3
Purpose of Action	LEVEL 2
Deficiency Photo1	
	West 35th Street
Violations	No violations recorded.
Pavers	Does not Exist
PLAYGROUNDS	Does not Exist
PLAYING SURFACE	Does not Exist
RETAINING WALLS	Does not Exist
SEATING	Does not Exist
SITE WALLS (NOT RETAINING WALLS)	Does not Exist
STAIRS/RAMPS: EXTERIOR	Does not Exist
ARTWORK	Does not Exist