

**NYC Department of Education  
Building Condition Assessment Survey 2023-2024**

**Architectural Inspection**

**X891**

**Asset: P.S. 91 MINISCHOOL - BRONX, 2170 AQUEDUCT AVENUE, BRONX, NY, 10453**

Inspection Id	Inspection Type	Time In	Last Edited
4381	ARCHITECTURAL - SENIOR	2024-04-01 07:08AM	2024-05-07 02:38PM
4554	ARCHITECTURAL - ASSOCIATE	2024-04-01 09:06AM	2024-04-07 02:55PM

**Asset Data**

Question	Answer
Was the Building Fully Accessible for Inspection?	Yes
Principal(s) Information	
Principal Name	Merideth Struhl Nasjlett
Principal Organization	P.S. 91 - Bronx
Meeting with Principal?	No
Principal Feedback	No Feedback from Principal
Custodian	Arturo Heras
Was the Custodian Present?	Yes
Fireman	Edwin Carrero
Was the Fireman Present?	Yes
Building Square Footage	7,200
Comments on the Area (for Athletic Field, Playing Surfaces, Leased Spaces)	None
Comments on the Stories (Floors) plus Basements	1 (no Basement)
Comments on the Year Built	1971
Student Population	96
Staff Population	12
Comments on the Number of Classrooms	6
Weather	Fair
Facade Photo	



Facade A and D - Northeast View

Main Entrance Photo



Exit 1 - Facing Main Asset

**NYC Department of Education  
Building Condition Assessment Survey 2023-2024**

**Architectural Inspection**

**X891**

Roof Photo



Do Stormwater Management/Green Infrastructure systems exist?

Type

Have any Systems/Major Building Components been upgraded?

Have there been any New Building Additions?

Tandem

Leased Space?

Roof 1 - Northwest View from Main Asset X091

No

No Storm Water Management Type Selected

Systems: Main entrance step/ramp repairs

Years: 2022

Systems: Exterior Door replacement (full), Windows / Guards replacement (full)

Years: 2002

Systems: Roofing replacement (full)

Years: 1996

No New Construction

No Tandem

No

**Priority Condition**

Exist Last Year?	Priority Category	Condition Description	Component Affected	Location Description	Person(s) Notified	Person(s) Title	Photo Image
No condition recorded							

**Structural Engineer Required**

Structural Condition Type	Condition Description	Component Affected	Location Description	Person(s) Notified	Person(s) Title	Photo Image
No condition recorded						

**Programmatic Accessibility**

Programmatic Accessibility Status Question	Response
Is the Primary or secondary entrance on an accessible route?	Yes
Is the building a multi-story building?	No
Do any of the following spaces exist? Classroom, Art Room, Auditorium, Cafeteria, Computer, Gymnasiums, Library, Multipurpose Room, Science Labs	Yes
For the spaces that do exist, are they ALL accessible?	Yes
Is there at least one Boys and Girls or Unisex toilet accessible In the building?	Yes

Physical Breakdown Structure	Exists	Complies	Required	Deficiency	Assistive Listening System	Fire Alarm Strobe
------------------------------	--------	----------	----------	------------	----------------------------	-------------------

**PROGRAMMATIC ACCESSIBILITY**

**Exterior Routes**

Exterior Entrances & Exits		Yes				
Exterior H/C Lifts	No		No			
Exterior Ramps and Railings	Yes	Yes				

**Interior Routes**

Corridor and Lobby H/C Lifts	No		No			
------------------------------	----	--	----	--	--	--

**NYC Department of Education  
Building Condition Assessment Survey 2023-2024**

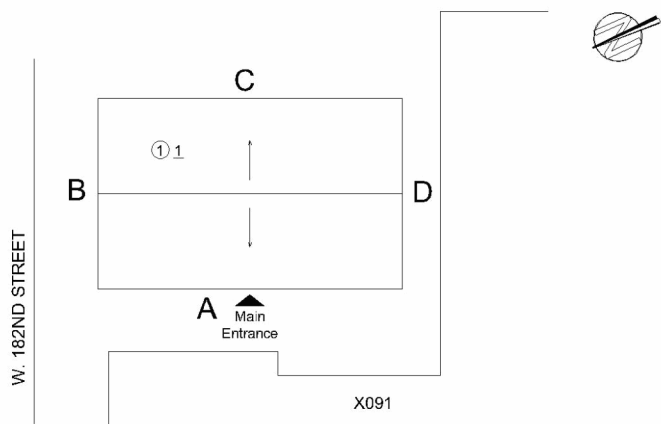
**Architectural Inspection**

**X891**

Physical Breakdown Structure	Exists	Complies	Required	Deficiency	Assistive Listening System	Fire Alarm Strobe
Interior Corridor Doors And Hardware	Yes	Yes				
Interior Corridors & Lobbies		Yes				
Interior Elevators	No					
Interior Lobby Doors And Hardware		Yes				
Interior Ramps	No					
<b>Rooms &amp; Spaces</b>						
Art Rooms	No					
Auditorium	No					
Cafeteria	No					
Classrooms						
1st Floor	Yes	Yes				
Computer Rooms	No					
Gymnasium	No					
Library	No					
Main Office	No					
Multi-purpose Room	No					
Nurse's Office	No					
Pool	No					
Science Lab	No					
Toilet Rooms (boys)						
1st Floor	Yes	Yes				
Toilet Rooms (girls)						
1st Floor	Yes	Yes				
Toilet Rooms (staff)						
1st Floor	Yes	Yes				

**Building Template**

X891



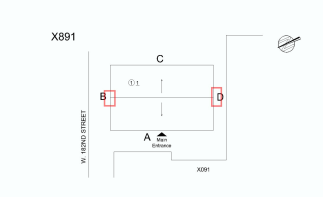

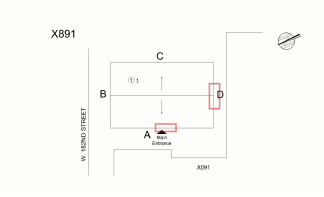
**Inspection**

Question	Response
Architectural	
EXTERIOR	Inspected

**NYC Department of Education  
Building Condition Assessment Survey 2023-2024**

*Architectural Inspection*

**X891**

Question	Response
<b>EXTERIOR</b>	
<b>AREAWAY</b>	Does not exist
<b>AWNINGS AND CANOPIES</b>	Does not exist
<b>CHIMNEY</b>	Does not exist
<b>COPING</b>	Does not exist
<b>CORNICE</b>	Does not exist
<b>DOORS</b>	Inspected
<b>DOORS AND FRAMES</b>	Inspected
Condition	3- Fair
Deficiency	METAL CLAD:DETERIORATED DOOR AND FRAME - MINOR DETERIORATION
Deficiency Location/Instance	
Deficiency Quantity	4
Quantity Uom	EACH
Potential Action	MAINTENANCE
Urgency of Action	PRIORITY 3
Purpose of Action	LEVEL 2
Deficiency Photo 1	
Deficiency Photo 2	Exit 3
Violations	No photo recorded No violations recorded
<b>DOOR HARDWARE</b>	Inspected
Condition	3- Fair
Deficiency	No deficiencies recorded
<b>LINTELS</b>	Does not exist
<b>TRANSOM/SIDE LIGHT</b>	Does not exist
<b>EXTERIOR WALLS</b>	Inspected
Material Type(s)	Masonry, Steel
Replacement Quantity	4,000
Replacement Uom	S.F.
Instance on Facades A and D (Masonry)	Inspected
Instance Condition	3- Fair
Instance Quantity	2,000
Instance Quantity Uom	S.F.
Deficiency	CONCRETE MASONRY UNIT:MINOR CRACKS AND SPALLING
Roof Plan Reference	

**NYC Department of Education  
Building Condition Assessment Survey 2023-2024**

*Architectural Inspection*

**X891**

Question	Response
----------	----------

**EXTERIOR**

**EXTERIOR WALLS**

Elevation



Elevation Reference  
Deficiency Quantity  
Quantity Uom  
Potential Action  
Urgency of Action  
Purpose of Action  
Deficiency Photo 1

Facades A and D  
40  
S.F.  
RESTITCH  
PRIORITY 3  
LEVEL 2



Deficiency Photo 2  
Violations

Above Exit 1  
No photo recorded  
No violations recorded

Instance on Facades B and C (Steel)

Inspected

Instance Condition

3- Fair

Instance Quantity

2,000

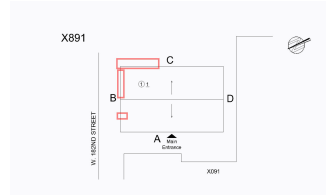
Instance Quantity Uom

S.F.

Deficiency

METAL PANEL:SEVERE DENTS

Roof Plan Reference



Elevation



Elevation Reference  
Deficiency Quantity  
Quantity Uom  
Potential Action  
Urgency of Action  
Purpose of Action

Facades B and C  
40  
S.F.  
REPLACE  
PRIORITY 4  
LEVEL 2

**NYC Department of Education  
Building Condition Assessment Survey 2023-2024**

*Architectural Inspection*



**X891**

Question	Response
<b>EXTERIOR</b>	
<b>EXTERIOR WALLS</b>	
Deficiency Photo 1	
Deficiency Photo 2	Facade B
Violations	No photo recorded
Deficiency	No violations recorded
Roof Plan Reference	METAL PANEL:DETERIORATED JOINTS
Elevation	
Elevation Reference	
Deficiency Quantity	Facade B
Quantity Uom	25
Potential Action	L.F.
Urgency of Action	REPAIR
Purpose of Action	PRIORITY 4
Deficiency Photo 1	LEVEL 2
Deficiency Photo 2	
Violations	Facade B
	No photo recorded
	No violations recorded
<b>EXTERIOR SOFFITS</b>	Inspected
Condition	2- Between Good and Fair
Deficiency	No deficiencies recorded
<b>LOADING DOCK</b>	Does not exist
<b>LOUVER</b>	Inspected
Condition	2- Between Good and Fair
Deficiency	No deficiencies recorded
<b>PARAPETS</b>	Does not exist
<b>PLAZA DECK</b>	Does not exist
<b>ROOF</b>	Inspected
<b>ROOFING</b>	Inspected

**NYC Department of Education  
Building Condition Assessment Survey 2023-2024**

*Architectural Inspection*

**X891**

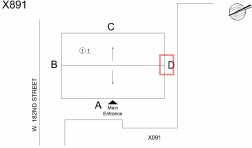

Question	Response
<b>EXTERIOR</b>	
<b>ROOF</b>	
<b>ROOFING</b>	
<b>ROOF HATCH/SMOKE HATCH</b>	Does not exist
<b>LEADERS, GUTTERS, DOWNSPOUTS, SCUPPERS</b>	Inspected
Condition	3- Fair
Deficiency	DAMAGED/MISSING
Deficiency Location/Instance	
Deficiency Quantity	15
Quantity Uom	L.F.
Potential Action	REPLACE
Urgency of Action	PRIORITY 4
Purpose of Action	LEVEL 2
Deficiency Photo 1	
Deficiency Photo 2	Facade A
Violations	No photo recorded No violations recorded
<b>ROOF BARRIER/FENCE</b>	Does not exist
<b>ROOF CAGE</b>	Does not exist
<b>ROOFING</b>	Inspected
Replacement Quantity	8,000
Replacement Uom	S.F.
Instance on Modified Bitumen:Roof 1	Inspected
Instance Roof Photo	
	Roof 1
Instance Condition	3- Fair
Instance Quantity	8,000
Instance Quantity Uom	S.F.
Does the roof have major mechanical equipment sitting on Dunnage Steel less than 18" above the Roofing?	No
Does this Roof Instance have a Sustainable Roof System?	No
Do solar panels exist on these roofs?	No
Is/Are the roof(s) suitable for Solar Panel installation?	No
Installation Year	1996
Source of Installation Year	Documented
Deficiency	MODIFIED BITUMEN:ROOFING:BEYOND USEFUL LIFE
Deficiency Location/Instance	Modified Bitumen:Roof 1



**NYC Department of Education  
Building Condition Assessment Survey 2023-2024**

*Architectural Inspection*

**X891**

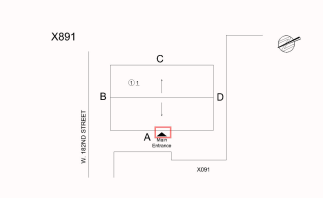
Question	Response
<b>EXTERIOR</b>	
<b>ROOF</b>	
<b>ROOFING</b>	
<b>ROOFING</b>	
Deficiency Quantity	8,000
Quantity Uom	S.F.
Potential Action	REPLACE
Urgency of Action	PRIORITY 1
Purpose of Action	LEVEL 2
Deficiency Photo 2	No photo recorded
Violations	No violations recorded
<b>ROOFING DRAINS</b>	Does not exist
<b>SPECIALTIES</b>	Inspected
<b>BULKHEAD/PENTHOUSE</b>	Does not exist
<b>CUPOLA/ SPIRES/ TOWERS</b>	Does not exist
<b>DORMER</b>	Does not exist
<b>DUNNAGE STEEL</b>	Does not exist
<b>SKYLIGHT/ROOF VENT</b>	Does not exist
<b>ROOF/GRAVITY TANK</b>	Does not exist
<b>STAIRS/RAMPS: EXTERIOR</b>	Inspected
<b>BUILDING CHEEK/FLANK WALLS</b>	Does not exist
<b>RAILINGS</b>	Inspected
Condition	2- Between Good and Fair
Deficiency	No deficiencies recorded
<b>STAIRS/RAMPS</b>	Inspected
Condition	3- Fair
Deficiency	CONCRETE:WORN-OUT TREAD/RISER/NOSING
Deficiency Location/Instance	
Deficiency Quantity	5
Quantity Uom	S.F.
Potential Action	REPLACE
Urgency of Action	PRIORITY 4
Purpose of Action	LEVEL 2
Deficiency Photo 1	
Deficiency Photo 2	Exit 3 No photo recorded
Violations	No violations recorded
Deficiency	CONCRETE:CRACKS/SPALLING - MINOR



**NYC Department of Education  
Building Condition Assessment Survey 2023-2024**

*Architectural Inspection*



**X891**

Question	Response
<b>EXTERIOR</b>	
<b>STAIRS/RAMPS: EXTERIOR</b>	
<b>STAIRS/RAMPS</b>	
Deficiency Location/Instance	
Deficiency Quantity	10
Quantity Uom	S.F.
Potential Action	REPAIR
Urgency of Action	PRIORITY 3
Purpose of Action	LEVEL 2
Deficiency Photo 1	
Deficiency Photo 2	Exit 1
Violations	No photo recorded No violations recorded
<b>WINDOWS</b>	Inspected
Replacement Quantity	300
Replacement Uom	S.F.
<b>EXTERIOR GUARDS</b>	Inspected
Condition	2- Between Good and Fair
Deficiency	No deficiencies recorded
<b>LINTELS</b>	Inspected
Condition	2- Between Good and Fair
Deficiency	No deficiencies recorded
<b>WINDOWS</b>	Inspected
Material Type(s)	Aluminum
Instance on Aluminum - Double Hung:Facades A, B and C	Inspected
Instance Condition	3- Fair
Instance Quantity	300
Instance Quantity Uom	S.F.
Installation Year	2002
Source of Installation Year	Documented
Are these windows insulated?	No
Deficiency	No deficiencies recorded
<b>INTERIOR</b>	Inspected
<b>POOLS</b>	Does not exist
<b>STRUCTURAL</b>	Inspected
<b>COLUMNS/BEAMS/BEARING WALLS</b>	Inspected
Condition	2- Between Good and Fair
Deficiency	No deficiencies recorded
<b>FLOOR STRUCTURE</b>	Inspected
Condition	2- Between Good and Fair
Deficiency	No deficiencies recorded
<b>FOUNDATION WALLS</b>	Inspected

**NYC Department of Education  
Building Condition Assessment Survey 2023-2024**

*Architectural Inspection*


**X891**

Question	Response
<b>INTERIOR</b>	
<b>STRUCTURAL</b>	
<b>FOUNDATION WALLS</b>	
Material Type(s)	Concrete
Condition	2- Between Good and Fair
Deficiency	No deficiencies recorded
<b>ROOF STRUCTURE</b>	Inspected
Condition	2- Between Good and Fair
Deficiency	No deficiencies recorded
<b>VAULTS-BUNKERS</b>	Does not exist
<b>AUDITORIUM</b>	Does not exist
<b>CAFETERIA</b>	Does not exist
<b>CLASSROOMS/CORRIDORS/ADMIN SPACES</b>	Inspected
<b>Ceiling</b>	Inspected
Condition	2- Between Good and Fair
Deficiency	ACOUSTIC TILES:DAMAGED/MISSING
Deficiency Location/Instance	Exit Vestibule 1, 2, Room 6, 17
Deficiency Quantity	40
Quantity Uom	S.F.
Potential Action	REPLACE
Urgency of Action	PRIORITY 3
Purpose of Action	LEVEL 2
Deficiency Photo 1	
	Exit Vestibule 2
Deficiency Photo 2	
	Room 6
Violations	No violations recorded
<b>Door(s)</b>	Inspected
Condition	2- Between Good and Fair
Deficiency	No deficiencies recorded
<b>Floor Finish</b>	Inspected
Condition	2- Between Good and Fair
Deficiency	No deficiencies recorded
<b>Walls</b>	Inspected
Condition	2- Between Good and Fair
Deficiency	No deficiencies recorded
<b>Specialties</b>	Does not exist
<b>GYMNASIUM</b>	Does not exist
<b>INTERIOR DOOR HARDWARE</b>	Inspected
Condition	3- Fair
Deficiency	No deficiencies recorded

**NYC Department of Education  
Building Condition Assessment Survey 2023-2024**

*Architectural Inspection*

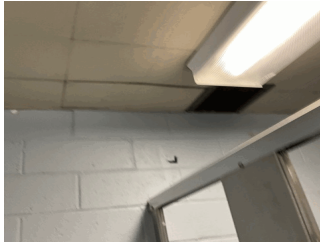

**X891**

Question	Response
<b>INTERIOR</b>	
<b>INTERIOR GUARDS</b>	Does not exist
<b>KITCHEN</b>	Does not exist
<b>LIBRARY</b>	Does not exist
<b>LOCKER ROOM</b>	Does not exist
<b>MULTI-PURPOSE ROOM</b>	Does not exist
<b>SCIENCE DEMO ROOM</b>	Does not exist
<b>SCIENCE LAB</b>	Does not exist
<b>SCIENCE PREP ROOM</b>	Does not exist
<b>SHOWER ROOM</b>	Does not exist
<b>STAIRS/RAMPS: INTERIOR</b>	Does not exist
<b>TOILET ROOMS - STAFF</b>	Inspected
<b>Ceiling</b>	Inspected
Condition	2- Between Good and Fair
Deficiency	No deficiencies recorded
<b>Door(s)</b>	Inspected
Condition	5- Poor
Deficiency	METAL:DAMAGED LOUVER
Deficiency Location/Instance	Room 3
Deficiency Quantity	1
Quantity Uom	EACH
Potential Action	MAINTENANCE
Urgency of Action	PRIORITY 3
Purpose of Action	LEVEL 2
Deficiency Photo 1	
Deficiency Photo 2	Room 3 No photo recorded
Violations	No violations recorded
<b>Floor Finish</b>	Inspected
Condition	2- Between Good and Fair
Deficiency	No deficiencies recorded
<b>Stalls</b>	Inspected
Condition	5- Poor
Deficiency	RUST - MAJOR
Deficiency Location/Instance	Room 2, 3
Deficiency Quantity	2
Quantity Uom	EACH
Potential Action	REPLACE
Urgency of Action	PRIORITY 3
Purpose of Action	LEVEL 2
Deficiency Photo 1	
	Room 2

**NYC Department of Education  
Building Condition Assessment Survey 2023-2024**

*Architectural Inspection*


**X891**

Question	Response
<b>INTERIOR</b>	
<b>TOILET ROOMS - STAFF</b>	
<b>Stalls</b>	
Deficiency Photo 2	No photo recorded
Violations	No violations recorded
<b>Walls</b>	Inspected
Condition	2- Between Good and Fair
Deficiency	No deficiencies recorded
<b>TOILET ROOMS - STUDENTS</b>	
<b>Ceiling</b>	Inspected
Condition	2- Between Good and Fair
Deficiency	METAL PAN:DAMAGED/MISSING
Deficiency Location/Instance	Boy's Toilet Room
Deficiency Quantity	10
Quantity Uom	S.F.
Potential Action	REPLACE
Urgency of Action	PRIORITY 3
Purpose of Action	LEVEL 2
Deficiency Photo 1	
Deficiency Photo 2	No photo recorded
Violations	No violations recorded
<b>Door(s)</b>	Inspected
Condition	5- Poor
Deficiency	METAL:DAMAGED LOUVER
Deficiency Location/Instance	Room 4, 5
Deficiency Quantity	2
Quantity Uom	EACH
Potential Action	MAINTENANCE
Urgency of Action	PRIORITY 3
Purpose of Action	LEVEL 2
Deficiency Photo 1	
Deficiency Photo 2	No photo recorded
Violations	No violations recorded
<b>Floor Finish</b>	Inspected
Condition	2- Between Good and Fair
Deficiency	CERAMIC TILE:BROKEN/MISSING TILES
Deficiency Location/Instance	Room 4, 5
Deficiency Quantity	10
Quantity Uom	S.F.

**NYC Department of Education  
Building Condition Assessment Survey 2023-2024**

*Architectural Inspection*

**X891**

Question	Response
<b>INTERIOR</b>	
<b>TOILET ROOMS - STUDENTS</b>	
<b>Floor Finish</b>	
Potential Action	REPLACE
Urgency of Action	PRIORITY 3
Purpose of Action	LEVEL 2
Deficiency Photo 1	
Deficiency Photo 2	Room 4
Violations	No photo recorded No violations recorded
<b>Stalls</b>	Inspected
Condition	2- Between Good and Fair
Deficiency	No deficiencies recorded
<b>Walls</b>	Inspected
Condition	2- Between Good and Fair
Deficiency	No deficiencies recorded
<b>LIFE SAFETY</b>	Inspected
<b>F.D. HOLDING AREA</b>	Does not exist
<b>STEEL STAIRS</b>	Does not exist
<b>SITE</b>	Not required

NYC Department of Education  
Building Condition Assessment Survey 2023-2024

*Architectural Inspection*

**X891**

Does the SCA expect asset to have artwork?

No